T 00

This manual provides installation information for the following Cleveland Steel Tool Ironworkers:

25 Ton	40 Ton	40 Ton C
50 Ton	55 Ton	60 Ton
65 Ton	75 Ton	100 Ton
100 Ton DX	120 Ton	Elite 110
Elite 110/65 D.O.		

Environmental Requirements at Work Station

The work station environment for your Cleveland Steel Tool Ironworker must meet the following minimum requirements:

Receiving the Ironworker

Cleveland Steel Tool Ironworking machinery is fully assembled and is shipped either by palletized custom wooden crate or by shrink wrapped wooden pallet for ease of transport and receiving.

Inspect the packaging for damage and follow shipping/receiving instructions as listed on the packaging prior to receiving the Ironworker into your facility.

When receiving your Ironworker, be prepared to safely move your machinery with a fork-lift rated for the following equipment weights:

Minimum Machinery Weights

25 Ton	453.6 kg / 1000 lb
40 Ton	861.8 kg / 1900 lb
40 Ton C	780.2 kg / 1720 lb
50 Ton	916.3 kg / 2020 lb
55 Ton	1124.9 kg / 2480 lb
60 Ton	1156.7 kg / 2550 lb
65 Ton	2154.6 kg / 4750 lb
75 Ton	1859.7 kg / 4100 lb
100 Ton	2109.2 kg / 4650 lb
100 Ton DX	2349.6 kg / 5180 lb
120 Ton	2494.8 kg / 5500 lb
ELITE 110	2440.3 kg / 5380 lb
ELITE 110/65	3891.8 kg / 8580 lb

Utilize best practices for fork-lift operation to handle material as close to the drive surface as possible with the widest spread and deepest penetration of forks effective to service the pallet. Forks should be adjusted and locked into the safety detent closest to the maximum available fork spread.

Unpacking/Moving the Ironworker

Your Cleveland Steel Tool Ironworker includes surface and remote mounted electrical cabling and hydraulic lines. Exercise caution when removing the factory supplied packaging. Do not cut electrical wiring or hydraulic hoses.

1. Unbolt/unpack Ironworker from its pallet using a 3/4 (19.05mm) socket. Wear appropriate personal protective equipment.
2. Lift Cleveland Steel Tool machinery using the designated fork locations and appropriately rated lifting equipment.
3. Move the Ironworker to the prepared workstation.

Anchoring Ironworker

Anchor the base of the Ironworker to the workstation floor using four 1/2 (12.7mm) wedge anchor bolts. Anchorage points are the front and rear of the fork-lift tubes. Secure the machinery with lock-nuts.

In the event the machinery needs to be relocated, reverse procedure.

Electrical Connection

Confirm with a certified electrician that the electrical supply to the terminal location powering your Ironworker meets the operating specifications (page 2) of the machine prior to electrical connection.

Confirm your electrical supply with the electrical specifications of the machine or accessory listed (page 2), and located on the Ironworker starter box. It is critical that a qualified electrician install your machinery as your Warranty protection does not cover incorrect wiring of electrical components at your site.

Prior to connecting your machine to the dedicated, protected power supply, match work station wiring to the power supply cable (Owner supplied) and the starter-box/motor specifications on the machinery. Install connections appropriately. Check for stability of connections.

If wiring through a plug/socket connection at the work station, match work station wiring to the socket (Owner supplied), plug (Owner supplied) and the power supply cable (Owner supplied) to the starter-box / motor specifications on the machinery. Install connections appropriately)55 (.)37 (Connections appropriately)55 (.)37 (C

T 00

1 General
Operator and Supervisor Information
Signal Word De nition
Signal Word Panel

2 Maintenance Precautions
Maintenance Schedule

4 Punch
Punch and Die Operating Clearances
Punch Tonnage Requirements

6 Bar Shear
Remove and replace stationary blade
Remove and replace moving blade

7 Angle Shear
Remove and replace stationary blade
Remove and replace moving blade

9 Pedestal Die
Punch and Die Operating Clearances
Punch Tonnage Requirements

Optional Tooling Maintenance

9 N otcher (

Operator and Supervisor Information

Reasonable, common sense safety precautions should be observed when maintaining the Ironworker or hydraulic accessory tool. The following precautions are described in order of their hazard.

Electrical Hazard

Dangerous high voltages are present inside the electrical enclosure of this product. Only quali ed, authorized, maintenance or service personnel should gain access to the electrical panel.

Lockout Power

Danger, circuits are live. Lockout / tagout upstream power source before any maintenance activity is performed.

Shear / Crush Hazard

Moving parts can cut and crush. Keep hands clear when servicing and maintaining the Ironworker.

Hydraulic Fluid Hazard

Hydraulic hoses are under pressure. Pressurized uid can pierce skin and cause severe injury. To avoid physical hazard, always wear personal protective equipment when servicing / maintaining the Ironworker.

Do Not Operate With Guard Removed

Physical barriers and guards have been designed and installed to protect the operator/maintenance personnel from moving parts that can pinch, cut and crush. If it is necessary to remove guarding when servicing the Ironworker, immediately replace guards after service and prior to power being restored to the machinery.

Refer to Manuals

For safe installation, operation and maintenance of the machine, read:

- Installation Manual
- Safety Instructions Manual
- Operations Manual
- Maintenance Manual

Wear Personal Protective Equipment

To avoid physical hazard wear protective eyewear, clothing, gloves, footwear, head-gear and hearing protection.

Slipping, Tripping and Falling

During routine maintenance hydraulic uid could spill outside of the machine footprint. Plug hose ends when working with hydraulic uids and clean up spills near the machinery in a timely manner.

Your Cleveland Steel Tool Ironworker will bene t from reasonable care and periodic maintenance. Reasonable care includes daily visual observation, general maintenance daily, weekly, monthly and at hourly milestone intervals by operator/maintenance personnel. Perform inspections and maintenance of the electrical, hydraulic, and mechanical systems of the Ironworker and any optional Cleveland Steel Tool hydraulic accessory connected to the Ironworker as follows:

Daily/Shift Change Visual Observation

Electrical System

Visually inspect incoming power and exposed surface conduit or c on the Ironworker for signs of damage. Cut, abraded or crushed ele cords may present an electrical hazard to the Operator and dama machinery. Replace fuses as necessary with same type and rating. See Figure 1 below.

Hydraulic System

Visually inspect exposed or surface mounted hydraulic-hoses a tings for signs of damage. Cut, abraded or crushed hydraulic hos leaking ttings may present a hydraulic uid hazard to the Oper and damage the machinery.

Plug hose ends when working with hydraulic uids and clean up near the machinery in a timely manner to reduce the likelihoo spills, trips and falls.

Mechanical System

Visually inspect guards and material hold-downs protecting mo parts. Guards and material hold-downs must remain on the ma for safe operation. Clear any material obstructions at the work st prior to visually inspecting moving parts of the machine. Cycle machine. Machine should operate smoothly in hydraulic extend retract mode.

Observe mechanical operating clearances. Punches, dies, angle notcher and bar shear blades should be evenly gapped and fr nicks, chips or burrs in their surface.

Ironworker operation creates small concussive sho0 0s270.107

Failure of any element of the daily/shift change visual observation will require maintenance of the affected Ironworker or accessory componentry. Please follow the following maintenance procedures.

General Maintenance - Daily

Lockout power to machine.

Clean your Ironworker daily with a brush and soft cloth lighly moistened with a mild, water based detergent solution. Remove lings, dirt, dust and grime and excess lubricant from working surfaces. All clean surfaces must be fully dry before powering up machine.

Grease all machine guides and pins supplied with a GREASE DAILY designation with NLGI Grade 2 (NLGI Service GC-LB) or equivalent premium, heavy duty lubricant.

General Maintenance - Weekly

Lockout power to machine.

Check blade tolerance. Maintain .010 clearance between xed and movable shear blades on 40, 50, 55, 60 and 65 Ton models at all times. Maintain .015 clearance between xed and movable shear blades on 75, 100, 100D, 120 Ton. 110 Elite and 110/65 DO Elite models at all times. Insert a feeler gauge between xed and movable blades to verify proper blade clearance and shear tolerance. Adjust tolerance of shear blades by relieving the locking nuts that secure the gib-pins to the Ironworker frame. Once loose, rotate gib-pins to push the operating center against the frame. Gap the angle and bar shear blades with the speci ed clearance and tighten the gib-pin lock nuts. Failure to maintain proper clearance will result in lower quality cuts, damage to blade, blade pockets and the potential to damage the Ironworker frame.

General Maintenance - Monthly

Angle Shear

CAUTI

Your Ironworker may include an angle iron shear as a standard feature. When maintained within tolerance, the angle iron shear will provide a distortion and burr free shear cut to mild steel angle iron. Angle iron shear blades are wearing parts and need to be maintained or replaced over time. When worn or chipped, shear blades must be replaced. Observe the following procedure when maintaining the Ironworker bar shear station.

Turn off power to machine by pressing the red stop/off button and lockout upstream power at the main electrical panel.

Remove and replace stationary blade:

1. Remove the material hold-down assembly from the Ironworker frame by removing the bolts that secure the guard / hold-down assembly to the Ironworker frame.
2. Remove blade bolts located behind the guard. Remove the stationary blades.
3. With blades removed, clean blade pocket of any dirt or debris.
4. Your shear blades have multiple cutting surfaces that can be used prior to full replacement of the part. Rotate the stationary blades to new cutting surface and reinstall in blade pocket.
5. Tighten the stationary blades back into the blade pocket.
6. Replace and secure the material hold-down and guarding to the Ironworker frame.

Remove and replace moving blade:

1. Remove the angle shear drop-off guard from the rear of the Ironworker frame.
2. Power on the machine and inch the moving center down to reveal blade bolts for the moving blade.
3. With bolts exposed, turn machine off and disconnect from po source.
4. Remove blade bolts and remove blade from the blade pocket
5. With blade removed, clean blade pocket of any dirt or debris.
6. Your shear blades have multiple cutting surfaces and two ra options that can be used prior to full replacement of-the part. tate the movable blade to the appropriate radius and new cu surface and reinstall in blade pocket. See diagram (above) fo rect radius designation.
7. Tighten the movable blade back into the blade pocket.
8. Replace the drop-off guard to the rear of the Ironworker frame
9. Return the machine to power and turn on to automatically re the moving center to its neutral position.
10. With a feeler gauge, check shear blade for correct operating c ance.
    - Maintain .010 clearance between xed and movable she blades on 40, 50, 55, 60 and 65 Ton models at all times.
    - Maintain .015 clearance between xed and movable she blades on 75, 100, 100D, E110, E110 / 65 and 120 Ton mo els at all times.
11. Adjust tolerance of shear blades by relieving the locking nuts secure the gib-pins to the Ironworker frame. Once loose, rotate pins to push the operating center against the frame. Gap the a and bar shear blades with the speci ed clearance and tighten gib-pin lock nuts.

    Failure to maintain proper clearance will result in lower qual ity cuts, damage to blades, blade pockets and the potential to damage the Ironworker frame.
12. Replace and secure the material guard and hold-down assem the Ironworker frame.

7. In the event that the punch and die are not aligned, rst con
that the punch is seated properly in the punch nut assembly.
seated properly, repeat step 5 . If seated properly, loosen the
under the die table allowing the table to be moved to center th
When aligned, tighten the table bolts to secure the table and re

Your Ironworker includes a standard or oversized pedestal punch and die assembly installed within the punch station. When worn or chipped, the punch and die must be replaced. Observe the fol lowing procedure when maintaining the Ironworker punch station.

Turn off power to machine by pressing the red stop/off button and lockout upstream power at the main electrical panel.

Maintain as follows:

1. Swing the Punch Stripper up or away from the punch by loosening the stripper assembly bolts.

2. Remove punch by loosening the punch nut assembly with factory supplied wrench.

3. Remove die by loosening the set screw at the front edge of the punch table and then lifting die from the die holder. If the die resists removal gently tap the die from the underside of the punch table to loosen the die for removal.

4. Install new die and tighten set screw. If loading a shaped die, align the whistle spot with the set screw and tighten.

5. Install new punch and tighten punch nut with wrench. If using a shaped punch, align the locating keystock of the punch with the corresponding slot within the punch stem assembly and tighten the punch nut with the wrench.

6. Check for punch and die alignment by powering up the machine and inching down the punch to meet the die with the foot pedal. Check to see that the punch is centered in the die.

Your Ironworker may include an Angle Notcher as an optional tool.

Your Ironworker may include an optional oversized punch and die assembly installed within the punch station. When worn or chipped, the punch and die must be replaced. Observe the fol lowing procedure when maintaining the Ironworker punch station.

Turn off power to machine by pressing the red stop/off button and lockout upstream power at the main electrical panel.

Maintain as follows:

1. Swing the Punch Stripper up or away from the punch by loosening the stripper assembly bolts.

2. Remove punch by loosening the punch nut assembly with factory supplied wrench.

3. Remove die by loosening the set screw at the side of the punch table and then lifting die from the die holder. If the die resists re moval gently tap the die from the underside of the punch table to loosen the die for removal.

4. Install new die and tighten set screw. If loading a shaped die, align the whistle spot with the set screw and tighten.

5. Install new punch and tighten punch nut with wrench. If using a shaped punch, align the locating keystock of the punch with the corresponding slot within the punch stem assembly and tighten the punch nut with the wrench.

6. Check for punch and die alignment by powering up the machine and inching down the punch to meet the die with the foot pedal. Check to see that the punch is centered in the die.

7. In the event that the punch and die are not aligned, rst con that the punch is seated properly in the punch nut assembly. seated properly, repeat step 5 . If seated properly, loosen the under the die table allowing the table to be moved to center th When aligned, tighten the table bolts to secure the table and re step 6.

8. Swing the stripper bar back in place allowing for minimal clear between the top of the material and the bottom of the stripper tighten the stripper bolts.

Punch and Die Operating Clearances

Maintain the following clearance between punch and die:

Your Cleveland Steel Tool Ironworker may include a 241 punch and die assembly installed within the punch station. When worn or chipped, the punch and die must be replaced. Observe the fol lowing procedure when maintaining the Ironworker punch station.

T 00

D

DANGER

WARNING

-
GREASE DAILY
DANGER
WARNING
NOTICE

Operations Diagram

- Machine Back

Operations Diagram

- Machine Left

- Punch Station
- Lockout Switch
- Power Cable

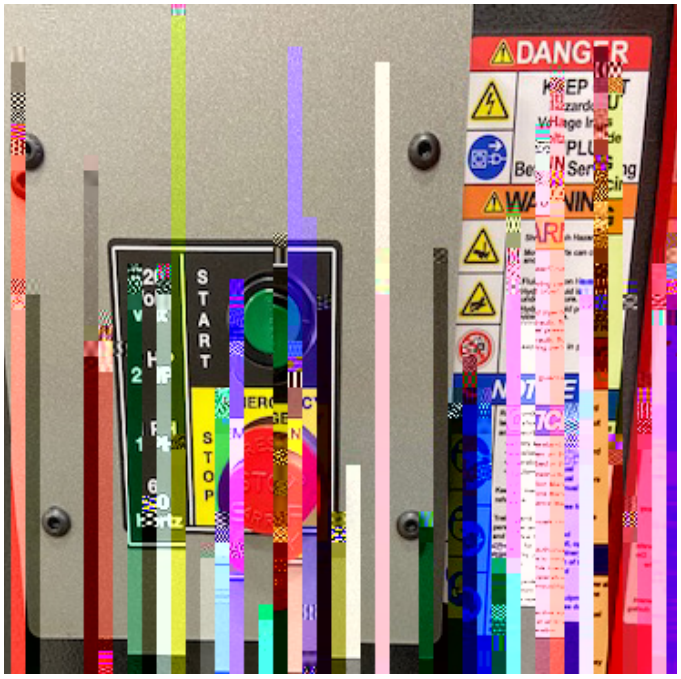

⚠DANGER

Cleveland Steel Tool Ironworkers feature a centrally located, integrated Control Panel. Hazardous voltage is present within the control panel. The panel should only be opened and serviced by authorized person

ANGLE SHEAR
MAX. CAPACITY
FLAT BAR SHEAR
WARNING

Bar Shear Station

⚠WARNING

Your Ironworker may include a bar shear as a standard feature. The bar shear will provide a distortion and burr free shear cut to mild steel bar stock as listed in the Ironworker Speci cations as well as described on the capacity labels positioned at the Bar Shear Station. The Bar Shear allows for straight or angled cutting operations. The material hold down adjusts with a simple hand crank to safely restrain the material being cut.

Bar shears are factory tuned to proper clearances and are ready to begin shearing operations.

Shear blades are wearing parts and will need to be maintained or replaced over time. Refer to the Maintenance Manual for blade maintenance, removal and replacement.

Safe Operation

Observe the following guidelines when operating the Bar Shear Station:

- Never exceed the capacities of the machine or tooling as described in the Ironworker speci cations or listed at the tooling station.
- Maintain correct operating clearance at bar shear and angle shear stations. Refer to the Maintenance Manual for tolerance adjustment instructions. Failure to maintain proper blade clearance will damage shear blades and shear blade support.
- Fully engage the material hold-down with the material being cut.
- Do not stack material to cut in the shear station.
- Perform complete shear operations only – partial shear cuts may jam the drop off side of the frame and could result in breakage and operator injury.
- Use shearing aids when working with small items at the shear station.

Bar Shear Operation

1. Clear bar shear station of any tools or debris prior to powerin machine on.
2. Turn machine on. The shear blades will be in their neutral pos Place bar stock on the feed table and push the material unde material hold-down. Position your desired cut mark adjacent t moving shear blade.
3. Secure the bar stock in the material hold-down by engaging handscrew into the material.
4. Clear your hands from the working area and press the foot pe activate the shear station.
5. When the cut is complete, release the foot pedal to automati return the shear blades to their neutral position. Reverse the screw to raise the manual material hold-down and remove material.

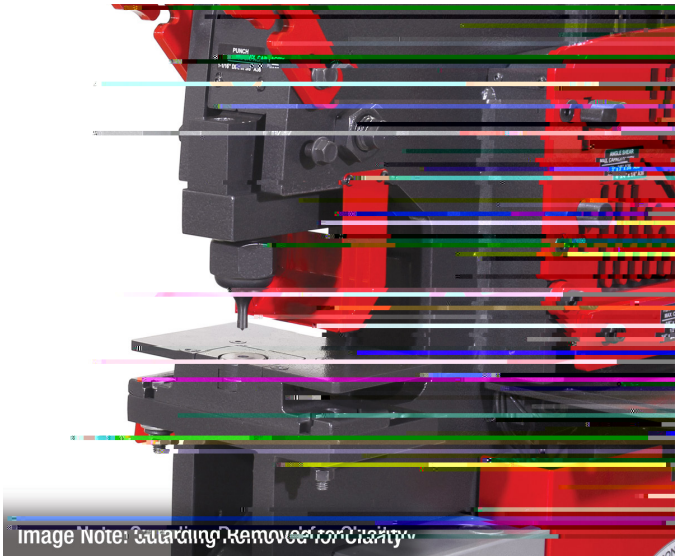

Image Note: Guarding Removed for Clarity

⚠WARNING

Your Ironworker is capable of punching materials as listed in the Ironworker Speci cations as well as described on the capacity labels positioned adjacent to the Punch station.

Setup

Your Cleveland Steel Tool Ironworker has been shipped with a punch and die installed within the punch station. Punch and dies are wearing parts and will need to be maintained or replaced over time. Refer to the Maintenance Manual for removal and replacement instructions. When changing the punch and die during typical operation please observe the following steps.

Turn off power to machine by depressing the red stop/off button or lockout upstream power at the main electrical panel.

1. Swing Stripper Bar away by loosening 4 bolts (2 on either side of punch station) with a 3/4” wrench. After swinging Stripper Bar away, re-tighten one bolt to prevent it falling back on you.
2. Remove punch by loosening the punch nut assembly with factory supplied wrench.
3. Remove die by loosening the set screw at the side or front edge of the punch table and then lifting die from the die holder. If the die resists removal gently tap the die from the underside of the punch table to loosen the die for removal.
4. Install new die and tighten set screw. If loading a shaped die, align the whistle spot with the set screw and tighten.
5.

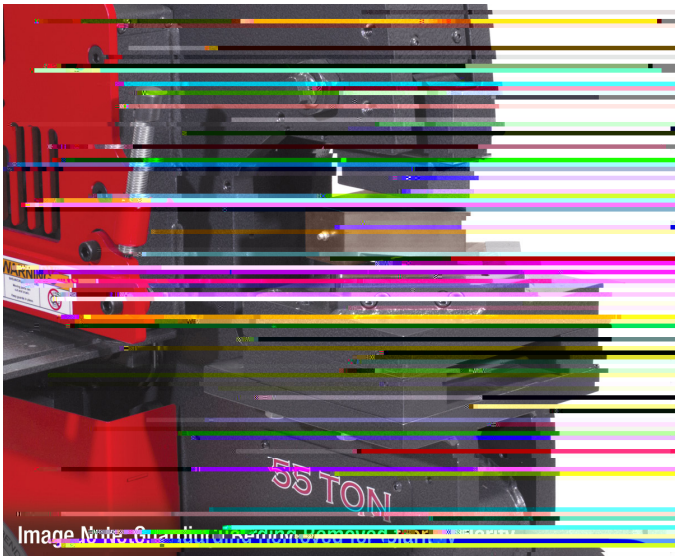

WA

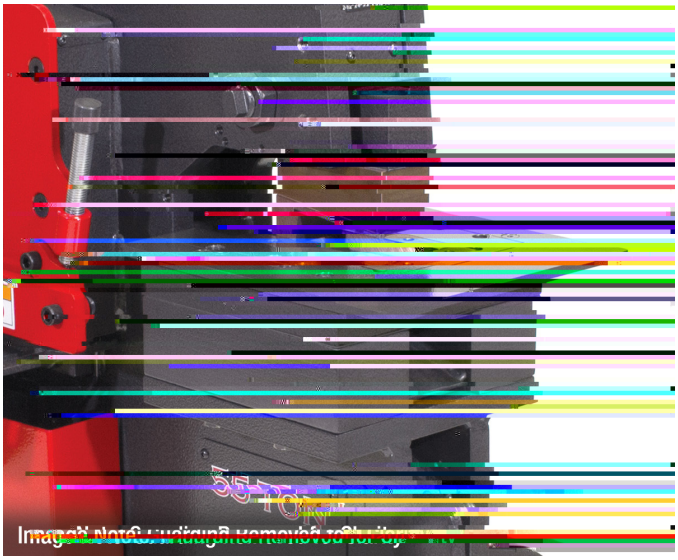

WARNING

Optional Notcher tooling will provide a distortion and burr free, three-sided shear cut to mild steel bar, plate, -or angle stock as list ed in the Ironworker Speci cations as well as the capacity labels positioned adjacent to the Notching Station. The optional Notcher tooling for an Cleveland Steel Tool Ironworker allows for shaped, straight or angled notch cutting applications.

Setup

Optional tooling and accessories t within the open station of the machine. Optional Notcher tooling is equipped with one, three-sided top notcher blade and three, four-sided bottom blades. The top blade is mounted to the moving “center” of the Ironworker, while the bottom three blades are secured into a base housing. If ordered as a factory installed option, your notcher assembly is 10 u01 24mlttoT 0he open sron.

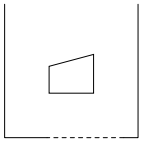

WARNING

Most Cleveland Steel Tool Ironworkers allow for Oversize Punch tooling to be installed in either the punch station or the open station. Refer to Ironworker Accessories specifications for capacities of oversize punch tooling.

Setup

Oversize punch tooling includes an oversize punch stripper' oversize punch holder assembly, oversized die table or oversized pedestal die table and an oversized wrench. Punch and dies are wearing parts and will need to be maintained or replaced over time. Refer to the Maintenance Manual for removal and replacement instructions. When installiing oversize punch and die tooling please observe the following steps.

Turn off power to machine by depressing the red stop / off button or lockout upstream power at the main electrical panel.

Install the oversize punch holder:

1. Oversize punch tooling can be installed in either the punch station or the opposite, open station end of the Ironworker. Remove existing tooling or debris from installation site.
2. Install oversize punch block /stem assembly to the moving center with hardware provided. Tighten assembly to moving center.
3. Insert oversize punch in oversize punch nut and thread onto oversize punch block /stem assembly. Tighten with wrench provided. If using a shaped punch, align the locating keystock of the punch with the corresponding slot within the punch stem assembly and tighten the punch nut with the wrench.

Install the oversize pedestal die table:

1. Clear the Ironworker base table of any debris.
2. Install the oversize die table with the die opening facing away from the Ironworker. Align the slotted holes of the die table with the base table holes and insert hardware provided.
3. With die table hardware loosely installed, insert die into die ho and secure with set screw.
4. Turn Ironworker on and inch down the punch to meet the die w the foot pedal jog control. Check to see that the punch is cent within the die.
5.

WARNIN

Optional Tooling - 241 Punch

WARNING

Your Ironworker is capable of punching materials as listed in the Ironworker Speci cations as well as described on the capacity la bels positioned at the Punch Station.

Setup

241 Punch tooling ts within the open or standard punch station of the machine. 241 Punch tooling includes an oversize punch stripper, punch holder assembly, die table and wrench. Punch and dies are wearing parts and will need to be maintained or replaced over time. Refer to the Maintenance Manual for removal and replacement instructions. When installing 241 punch and die tooling please observe the following steps.

Turn off power to machine by depressing the red stop / off button or lockout upstream power at the main electrical panel.

Install the punch holder:

1. Clear any tooling or debris from the tooling installation site.
2. Secure the 241 punch holder to the operating center by rst re moving the stud from the holder. Place the holder to the operating center with the tapped hole positioned to the outside of the center. Install holder with two 1/2” SHCS bolts and tighten. Install stud to holder with four 3/8” SHCS bolts and tighten.

Install the die table:

1. Place the 241 die table and slug chute on the support table base and loosely install four 1/2” bolts (provided) through the underside of the support table into the 241 die table.
2. Install new oversize die and tighten set screw. If loading a shaped die, align the whistle spot with the set screw and tighten.
3. Install new 241 punch and tighten with spanner wrench. If using a shaped punch, align the locating keystock (not provided) of the punch with the corresponding slot within the punch stem assem bly and tighten the punch nut with the wrench.
4. Check for punch and die alignment by powering up the machi and slowly inching down the punch to meet the die with the fo pedal. Check to see that the punch is centered in the die. Turn power to machine.
5. In the event that the punch and die are not aligned, simply loo the bolts under the table allowing the table to be moved to ce the die. When aligned, tighten the table bolts to secure the tab
6. Install and secure the 241 stripper bar to the ironworker frame allowing for minimal clearance between the top of the materia be punched and the bottom of the stripper.

Safe Operation

Observe the following guidelines when operating the 241 Punch S

- Follow manufacturers punch and die clearance recommendat as shown (Figure1, Punch Operation) in this manual.
- Never exceed the capacities of the machine or tooling as described in the Ironworker speci cations or listed at the toolin station.
- The thickness of the material you are punching should not ex the diameter of the punch being used
- Check punch and die alignment after every tooling change or extended punch operation.

VE N

Operator and Supervisor Information

This is one of four manuals supplied with your machine.

- Installation Manual
- Safety Instructions Manual
- Operations Manual
- Maintenance Manual

READ ALL MANUALS BEFORE OPERATING MACHINERY. Operating machinery before reading and understanding the contents of all four manuals greatly increases the risk of injury.

Each of the four machine manuals describes ‘best practices’ in handling, installing, operating and maintaining your machine. The contents of each manual is subject to change without notice due to improvements in the machinery or changes in National or International standards.

All rights reserved. Reproduction of this manual in any form, in whole or in part, is not permitted without the written consent of Cleveland Steel Tool.

Keep all manuals close to the machine to allow for easy reference when necessary.

Provide operators with sufficient training and education in the basic functions of the machine prior to machine operation.

Do not allow for operation of the machine by unqualified personnel. Cleveland Steel Tool is not liable for accidents arising from unskilled, untrained operation.

Do not modify or change the machine without written authorization from Cleveland Steel Tool. Unauthorized modification to a machine may result in serious operator injury, machine damage and will void your machine warranty.

Never leave a powered machine unattended. Turn Off Machinery before walking away.

This machine is manufactured for use by able bodied and able minded operators only. Never operate machinery when tired or under the influence of drugs or alcohol.

Do not resell, relocate or export to a destination other than to the original point of sale. Cleveland Steel Tool has designed this machine to meet the standards of the original receiving country and is not liable for meeting any governing body or performance standards beyond those of the original receiving country.

Signal Word Panel • Machine Back

WARNING		
	M	

Signal Word Panel • Machine Right

Danger Panel

Electrical Hazard

This is the electrical hazard symbol. It indicates there are dangerous high- volt ages present inside the enclosure of this product. ONLY quali ed, authorized, -main tenance, service or Certi ed Electricians should gain access to electrical panel. Do not operate this equipment from any power source that does not match the voltage rating stamped on the equipment. Refer to the Manufacturer's Identi cation Label for operational requirements.

Lockout Power

Danger circuits are live. Lockout/Tagout the upstream power source. Lockout/Tagout machinery according to Employer proce dures.

Voltage (Varies by consumer requirement)

Indication of operating power requirements. This product should be operated only from the type of source indicated on the manu facturer's identi cation label Installation should be in compliance with applicable sections of the National Electric Code. Consult your local building code before installing.

Phase (Varies by consumer requirement)

Indication of electrical phase requirements. This product should be operated only from the type of source indicated on the manu facturer's identi cation label Installation should be in compliance with applicable sections of the National Electric Code. Consult your local building code before installing.

Horsepower (Varies by model)

Indication of horsepower requirements. This product should be operated only from the type of source indicated on the manufactur er's identi cation label Installation should be in compliance with applicable sections of the National Electric Code. Consult your local building code before installing.

Hertz (Varies by consumer requirement)

Indication of electrical cycles per second. This product should be operated only from the type of source indicated on the manu facturer's identi cation label Installation should be in compliance with applicable sections of the National Electric Code. Consult your local building code before installing.

Warning Panel

Si1 0 0 11 103.68 313.7841 Tm [(Th

Notice Panel

Ironworker Operation

This manual outlines the basic functions associated with typical Ironworker opera tions and is neither intended to create a comprehensive list of, nor describe every operation possible with an Ironworker

Additional Graphic Information

Electronics

Electronic equipment must be recycled as required by local environmental law. Do not dispose of by adding to the municipal waste stream.

Metal

Metal components must be recycled as required by local environmental law. Do not dispose of by adding to the municipal waste stream.

C